

# MAX32665–MAX32668 ERRATA SHEET

## Revision A1 Errata

*The errata listed below describe situations where components of this revision perform differently than expected or differently than described in the data sheet. Maxim Integrated Products, Inc. may, at its own discretion, take future steps to correct these errata when the opportunity to redesign the product presents itself. Prior to that, Maxim has determined the following potential workarounds that customers may want to consider when addressing one of the situations described below.*

*This errata sheet only applies to components of this revision. These components are branded on the topside of the package with a six-digit code in the form yywwRR, where yy and ww are two-digit numbers representing the year and work week of manufacture, respectively, and RR is the revision of the component. To obtain an errata sheet on other die revisions, visit the Maxim website at [www.maximintegrated.com/errata](http://www.maximintegrated.com/errata).*

### 1) SPIXF BUS IDLE FEATURE CANNOT BE DISABLED

**Description:**

The SPIXF bus idle feature cannot be disabled. The SPIXF will unexpectedly force the start of a new transaction, requiring resending of the SPI transaction header, if two consecutive reads of the cache both generate a cache miss. (14358)

**Workaround:**

Set the SPIXF\_BUS\_IDLE.busidle to 0x1 to approximate the operation of the SPIXF when the bus idle feature is disabled. This will have minimal effect on sequential code execution.

### 2) QSPI IN SLAVE MODE 0 OR MODE 2 DOES NOT OPERATE AS EXPECTED IF Tx FIFO IS FULL

**Description:**

When the QSPIn\_SS0 signal transitions to its active state, the first bit of the first byte of the MISO signal is always 0 if the transaction starts when the Tx FIFO is full. (14354)

**Workaround:**

Ensure that the number of bytes in the Tx FIFO is always less than 32 ( $QSPIn\_DMA.tx\_fifo\_cnt < 32$ ).

### 3) EXTERNAL CAPACITORS REQUIRED FOR RTC OPERATION

**Description:**

External capacitors are required to meet the loading requirements for RTC accuracy. (14416)

**Workaround:**

Specific values are based on PCB and internal oscillator capacitances. Contact factory for details on the characterization procedure.

# MAX32665–MAX32668

## REV A1 ERRATA

### 4) AUDIO SYSTEM CLOCK AND SAMPLE RATE ACCURACIES GOVERNED BY HSCLK SPECIFICATION

**Description:**

The HSCLK clock is the source for the digital audio peripheral that has an accuracy of approximately  $\pm 2.5\%$ . Refer to the MAX32665–MAX32668 data sheet *Electrical Characteristics* table for guaranteed minimum and maximum values of  $f_{\text{HSCLK}}$ . (14416)

**Workaround:**

Ensure the application can tolerate audio clock and sample rate frequencies derived from the HSCLK.

### 5) SPI MODE 1 AND MODE 3 OPERATION MAY BE AFFECTED WHEN QSPIn\_CLK\_CFG.SCALE = 0

**Description:**

The following settings are invalid when operation the SPI is operating in mode 1 or mode 3:

SCALE=0, CLOCKHI=0, CLOCKLO=0

SCALE=0, CLOCKHI=1, CLOCKLO=1.

**Workaround:**

Do not use the invalid settings. The operating speeds generated by all other field combinations are valid.

# MAX32665–MAX32668

## REV A1 ERRATA

### Revision History

REVISION NUMBER	REVISION DATE	DESCRIPTION	PAGES CHANGED
0	7/19	Initial release	—
1	12/20	Updated erratum 1, deleted erratum 3, added erratum 5	1, 2

*Maxim Integrated cannot assume responsibility for use of any circuitry other than circuitry entirely embodied in a Maxim Integrated product. No circuit patent licenses are implied. Maxim Integrated reserves the right to change the circuitry and specifications without notice at any time.*

**Maxim Integrated 160 Rio Robles, San Jose, CA 95134 USA 1-408-601-1000**

© 2020 Maxim Integrated Products, Inc. Maxim Integrated and the Maxim Integrated logo are trademarks of Maxim Integrated Products, Inc.