

MAX32665–MAX32668 ERRATA SHEET

Revision A3 Errata

The errata listed below describe situations where components of this revision perform differently than expected or differently than described in the data sheet. Maxim Integrated Products, Inc. may, at its own discretion, take future steps to correct these errata when the opportunity to redesign the product presents itself. Prior to that, Maxim has determined the following potential workarounds that customers may want to consider when addressing one of the situations described below.

This errata sheet only applies to components of this revision. These components are branded on the topside of the package with a six-digit code in the form yywwRR, where yy and ww are two-digit numbers representing the year and work week of manufacture, respectively, and RR is the revision of the component. To obtain an errata sheet on other die revisions, visit the Maxim website at www.maximintegrated.com/errata.

1) SPIXF BUS IDLE FEATURE CANNOT BE DISABLED

Description:

The SPIXF bus idle feature cannot be disabled. The SPIXF will unexpectedly force the start of a new transaction, requiring resending of the SPI transaction header, if two consecutive reads of the cache both generate a cache miss. (14358)

Workaround:

Set SPIXF_BUS_IDLE.busidle to 0x1 to approximate the operation of the SPIXF when the bus idle feature is disabled. This will have minimal effect on sequential code execution.

2) EXTERNAL CAPACITORS REQUIRED FOR RTC OPERATION

Description:

External capacitors are required to meet the loading requirements for RTC accuracy. (14416)

Workaround:

Specific values are based on PCB and internal oscillator capacitances. Contact factory for details on the characterization procedure.

3) SPI MODE 1 AND MODE 3 OPERATION MAY BE AFFECTED WHEN QSPIn_CLK_CFG.SCALE = 0

Description:

The following settings are invalid when operation the SPI is operating in mode 1 or mode 3: (13390)

SCALE=0, CLOCKHI=0, CLOCKLO=0
SCALE=0, CLOCKHI=1, CLOCKLO=1

Workaround:

Do not use the invalid settings. The operating speeds generated by all other field combinations are valid.

MAX32665–MAX32668

REV A3 ERRATA

Revision History

REVISION NUMBER	REVISION DATE	DESCRIPTION	PAGES CHANGED
0	12/20	Initial release	—

Maxim Integrated cannot assume responsibility for use of any circuitry other than circuitry entirely embodied in a Maxim Integrated product. No circuit patent licenses are implied. Maxim Integrated reserves the right to change the circuitry and specifications without notice at any time.

Maxim Integrated 160 Rio Robles, San Jose, CA 95134 USA 1-408-601-1000

© 2020 Maxim Integrated Products, Inc. Maxim Integrated and the Maxim Integrated logo are trademarks of Maxim Integrated Products, Inc.